



Dual Function LED Exterior Wall Pack with Integral Battery Series OWEL-EM REV 06.15.08

INSTALLATION INSTRUCTIONS AND OWNER'S MANUAL

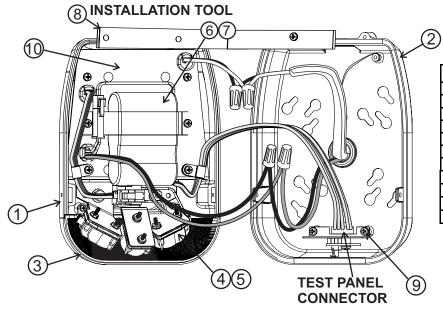

ITEM	QTY	P/N	DESCRIPTION
1	1	343004-X	HOUSING "X" COLOR
2	1	586102	BASE UNIT EQUIP.
3	1	586104	LENS
4	1	343005	LED 2- LAMP ASSBY KIT
5	1	343006	LED 3- LAMP ASSBY KIT
6	1	SEE SPEC	BATTERY STD
7	1	SEE SPEC	BATTERY LT
8	1	343012	INSTALLATION TOOL
9	1	343007	TEST PANEL ASSBY
10	1	343013	POWER SUPPLY ASSBY
11	1	343035	GASKET

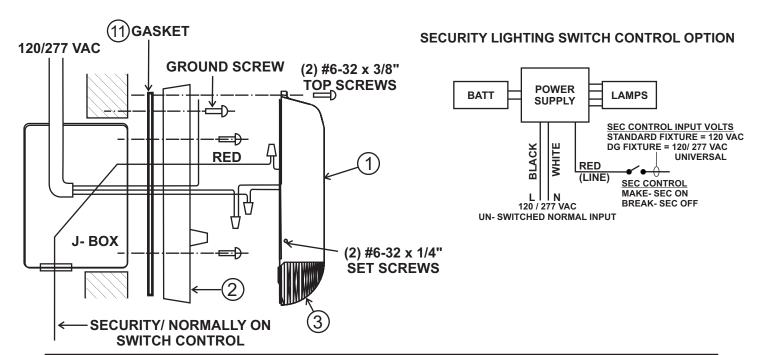

IMPORTANT SAFEGUARDS READ AND FOLLOW ALL SAFETY INSTRUCTIONS

- 1. Disconnect AC power before servicing.
- 2. Refer to wiring diagram for proper connections.
- 3. All servicing should be performed by qualified personnel.
- Consult your local building code for approved wiring and installation.
- 5. Do not use this equipment for other than intended use.
- 6. Do not let power cords touch hot surfaces.


- Mount and secure the fixture at a location and height to avoid ready access and tampering by unauthorized persons
- 8. The use of accessory equipment is not recommended by the manufacturer and may cause an unsafe condition.
- 9. Suitable for wet locations. See product label for temperature limitations.

SAVE THESE INSTRUCTIONS

Installation Instructions


REV 06.15.08

Product is supplied assembled. To separate Housing and Base, remove two #6-32 screws at top of housing and back out two #6-32 set screws on each side.

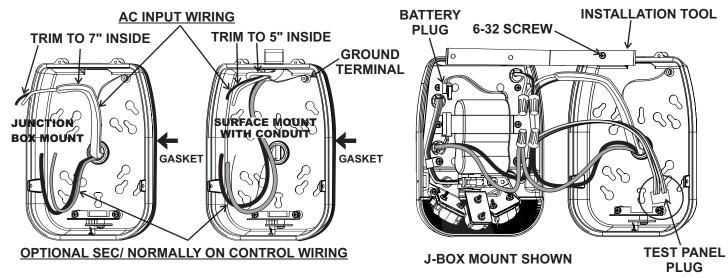

1. Route AC wiring into j-box or via external conduit. For j-box mount, remove knockouts as required. Route AC wiring through gasket and into Base, secure to j-box or surface. Trim and shape AC wiring and optional SEC/Normally On switch control wiring as shown. Connect AC GROUND wire to screw boss provided.

2. Attach Installation Support Tool to Base with 6-32 screw and insert two pins into upper holes of Housing as shown. The Housing assembly will be supported in a convenient position for wiring.

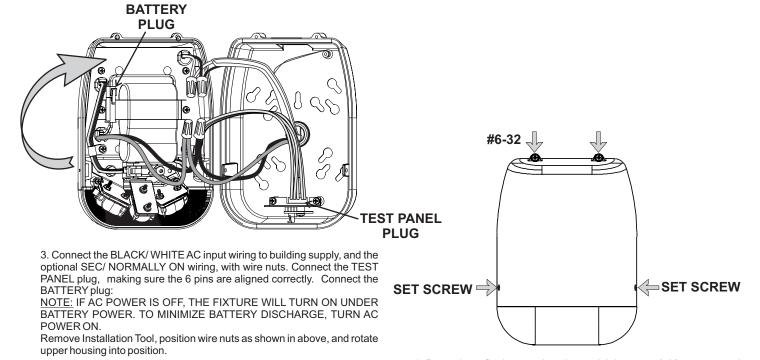

4. Press down firmly to seal gasket and tighten two 6-32 screws and two set screws. Turn AC power ON and press the PUSH TO TEST button to check operation. Full battery charge requires 24 hrs.